

XPass D2

Firmware Revision Notes

Version 1.7.2

English

EN 301.00.XPD2 (REV 2) V1.7.2

Firmware Version 1.7.2 (Build No. 1.7.2_231102)

Release: 2023-11-03



Devices with the new BLE chip cannot downgrade to a lower version after upgrading the firmware to v1.7.0 or higher. Devices with existing BLE chips can be downgraded to a lower version.

For more information, check the serial number of the device and contact the Suprema. (supremainc.com)

Bug Fixes

1. When running the Device Manager application v1.1.8 on iOS, certain devices do not connect. (Affects version: v1.7.0)

Firmware Version 1.7.1 (Build No. 1.7.1_230405)

Release: 2023-04-05



Devices with the new BLE chip cannot downgrade to a lower version after upgrading the firmware to v1.7.0 or higher. Devices with existing BLE chips can be downgraded to a lower version.

For more information, check the serial number of the device and contact the Suprema. (supremainc.com)

New Features and Improvements

1. Supports **Custom Smart Card Layout**.
 - XPass D2 firmware v1.7.1 or higher.
2. Supports **Keypad Backlight** configuration.
 - XPass D2 (XPD2-GKDB) firmware v1.7.1 or higher.

Firmware Version 1.7.0 (Build No. 1.7.0_220921)

Release: 2022-09-21



Devices with the new BLE chip cannot downgrade to a lower version after upgrading the firmware to v1.7.0 or higher. Devices with existing BLE chips can be downgraded to a lower version.

For more information, check the serial number of the device and contact the Suprema. (supremainc.com)

New Features and Improvements

1. Supports a new BLE (Bluetooth Low Energy) chip.
 - The BLE chip parts of the hardware have been changed, and the firmware has been upgraded to be compatible with both the existing and new BLE chips.
2. Improved setting of the byte order for smart cards.
 - Improved to display valid values through Wiegand or OSDP when the AoC (Access on Card) ID issued by BioStar 2 is set to Alphanumeric.

Bug Fixes

1. Intermittent Mobile Card not authenticating (Affects version: v1.4.0).
 - Improved BLE Micom Firmware and BLE Recovery RFCore.
2. When FaceStation F2 and Xpass D2 are connected as master-slave, Xpass D2 cannot authenticate with Mobile Card (Affects version: v1.4.0).

Firmware Version 1.6.0 (Build No. 1.6.0_220223)

Release: 2022-03-02

New Features and Improvements

1. Supports setting the byte order of CSN card output data when using the device as a Wiegand reader or OSDP reader by connecting with a 3rd-party controller.
2. Supports setting the byte order for smart cards.
 - Supports setting the byte order of data to be output to Wiegand or OSDP.
3. Supports new features and improvements of the Device Manager app (v1.1.4 or later).
 - Supports Byte order setting for CSN card and smart card.
 - Added LED operation of the device according to auth mode operation.
4. Supports a new BLE (Bluetooth Low Energy) chip.
 - The BLE chip part of the hardware have been changed, and the firmware has been upgraded to be compatible with both the existing and new BLE chips.

Bug Fixes

1. The Wiegand value displayed on the card scan of the Device Manager app was different from the value output from BioStar 2 (Affects version: v1.4.0).

Firmware Version 1.5.0 (Build No. 1.5.0_210408)

Release: 2021-04-12

New Features and Improvements

1. The transmission power level for Bluetooth Low Energy (BLE) has been adjusted.

Bug Fixes

1. Card data were output with the wrong BitCount while the device was communicating with a 3rd party controller via OSDP. (Affects version: v.1.4.0)
2. Modified to output 4 bits for each key input on the keypad while the device was set as a Wiegand reader. (XPD2-GKDPB) (Affects version: v.1.4.0)
3. The OSDP LED Temporary command did not work properly. (Affects version: v.1.4.0)
4. Delay occurred when reading a smart card that contained credentials which the device did not support while the device was set as a Wiegand reader. (Affects version: v.1.0.0)

Firmware Version 1.4.2 (Build No. 1.4.2_201012)

Release: 2020-10-15

New Features and Improvements

1. Support to mobile key deletion when deleting device data from the Airfob application.

Bug Fixes

1. Improved the function to operate according to Timer Count when setting the Temporary LED (Affects version: 1.0.0)
2. Device responded that it supports transparent mode by OSDP_PDCAP when connecting as slave while it does not support it. (Affects version: 1.0.0)
3. Values that did not comply with the OSDP specification were sent when pressing the keypad. (Affects version: 1.0.2)

Firmware Version 1.4.1 (Build No. 1.4.1_200721)

Release: 2020-07-22

New Features and Improvements

1. Improved changes to be applied immediately when changing the LED settings.
2. Added a feature to restore the Config area.

Firmware Version 1.4.0 (Build No. 1.4.0_200429)

Release: 2020-05-15

Initial firmware developed.



Suprema Inc.

17F Parkview Tower, 248, Jeongjail-ro, Bundang-gu, Seongnam-si, Gyeonggi-do, 13554, Rep. of KOREA
Tel: +82 31 783 4502 | Fax: +82 31 783 4503 | Inquiry: sales_sys@supremainc.com



For more information about Suprema's global branch offices,
visit the webpage below by scanning the QR code.
<https://supremainc.com/en/about/global-office.asp>

© 2023 Suprema Inc. Suprema and identifying product names and numbers herein are registered trade marks of Suprema, Inc.
All non-Suprema brands and product names are trademarks or registered trademarks of their respective companies.
Product appearance, build status and/or specifications are subject to change without notice.